

INA75X-Q1

Functional Safety FIT Rate, FMD and Pin FMA



Table of Contents

1 Overview	1
2 Functional Safety Failure In Time (FIT) Rates	2
2.1 REM (VQFN – 14) Package.....	2
3 Failure Mode Distribution (FMD)	3
4 Pin Failure Mode Analysis (Pin FMA)	4
4.1 REM (VQFN – 14) Package.....	4
5 Revision History	6

Trademarks

All trademarks are the property of their respective owners.

1 Overview

This document contains information for INA75X-Q1 (REM (VQFN – 14) package) to aid in a functional safety system design. Information provided are:

- Functional safety failure in time (FIT) rates of the semiconductor component estimated by the application of industry reliability standards
- Component failure modes and distribution (FMD) based on the primary function of the device
- Pin failure mode analysis (pin FMA)

Figure 1-1 shows the device functional block diagram for reference.

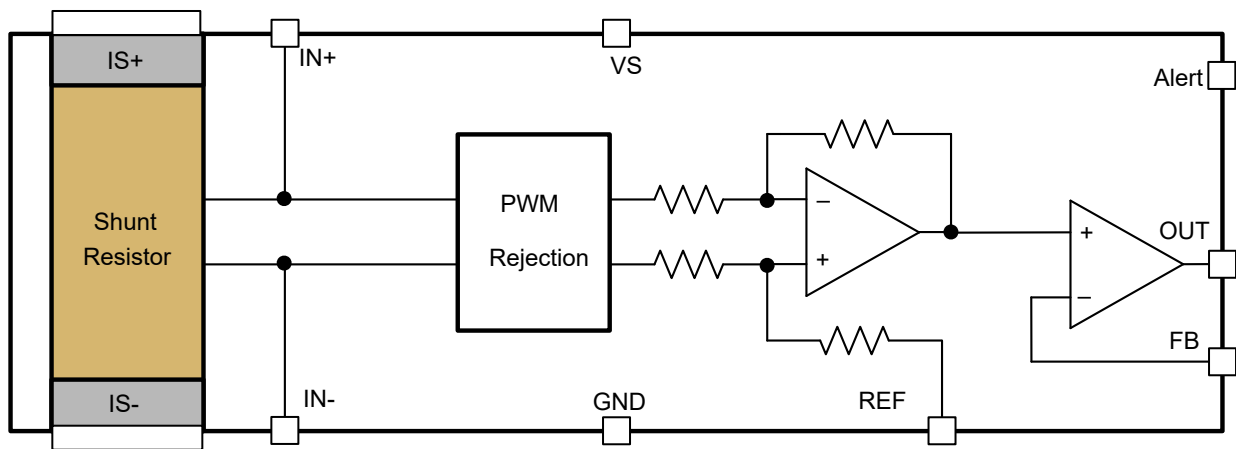


Figure 1-1. Functional Block Diagram

INA75X-Q1 was developed using a quality-managed development process, but was not developed in accordance with the IEC 61508 or ISO 26262 standards.

2 Functional Safety Failure In Time (FIT) Rates

2.1 REM (VQFN – 14) Package

This section provides functional safety failure in time (FIT) rates for the REM (VQFN – 14) package of INA75X-Q1 (INA750A, INA750B, INA751A, and INA751B) based on two different industry-wide used reliability standards:

- [Table 2-1](#) provides FIT rates based on IEC TR 62380 / ISO 26262 part 11
- [Table 2-2](#) provides FIT rates based on the Siemens Norm SN 29500-2

Table 2-1. Component Failure Rates per IEC TR 62380 / ISO 26262 Part 11

FIT IEC TR 62380 / ISO 26262	FIT (Failures Per 10 ⁹ Hours)
Total component FIT rate	15
Die FIT rate	5
Package FIT rate	10

The failure rate and mission profile information in [Table 2-1](#) comes from the reliability data handbook IEC TR 62380 / ISO 26262 part 11:

- Mission profile: Motor control from table 11 or figure 16
- Power dissipation: 980mW
- Climate type: World-wide table 8 or figure 13
- Package factor (λ_3): Table 17b or figure 15
- Substrate material: FR4
- EOS FIT rate assumed: 0 FIT

Table 2-2. Component Failure Rates per Siemens Norm SN 29500-2

Table	Category	Reference FIT Rate	Reference Virtual T _J
5	CMOS, BICMOS ASICs, analog and mixed \leq 50V Supply	60 FIT	70°C

The reference FIT rate and reference virtual T_J (junction temperature) in [Table 2-2](#) come from the Siemens Norm SN 29500-2 tables 1 through 5. Failure rates under operating conditions are calculated from the reference failure rate and virtual junction temperature using conversion information in SN 29500-2 section 4.

3 Failure Mode Distribution (FMD)

The failure mode distribution estimation for INA75X-Q1 in [Table 3-1](#) comes from the combination of common failure modes listed in standards such as IEC 61508 and ISO 26262, the ratio of sub-circuit function size and complexity, and from best engineering judgment.

The failure modes listed in this section reflect random failure events and do not include failures resulting from misuse or overstress.

Table 3-1. Die Failure Modes and Distribution

Die Failure Modes	Failure Mode Distribution (%)
VOUT OPEN (Hi-Z)	5
VOUT stuck (high or low)	30
VOUT is functional, not in specification	35
Alert (false trip or failure to trip)	30

4 Pin Failure Mode Analysis (Pin FMA)

This section provides a failure mode analysis (FMA) for the pins of the INA75X-Q1 (REM (VQFN – 14) package). The failure modes covered in this document include the typical pin-by-pin failure scenarios:

- Pin short-circuited to ground (see [Table 4-2](#))
- Pin open-circuited (see [Table 4-3](#))
- Pin short-circuited to an adjacent pin (see [Table 4-4](#))
- Pin short-circuited to VS (see [Table 4-5](#))

[Table 4-2](#) through [Table 4-5](#) also indicate how these pin conditions can affect the device as per the failure effects classification in [Table 4-1](#).

Table 4-1. TI Classification of Failure Effects

Class	Failure Effects
A	Potential device damage that affects functionality.
B	No device damage, but loss of functionality.
C	No device damage, but performance degradation.
D	No device damage, no impact to functionality or performance.

Following are the assumptions of use and the device configuration assumed for the pin FMA in this section:

- $T_A = -40^{\circ}\text{C}$ to $+125^{\circ}\text{C}$
- $V_S = 5.0\text{V}$
- $V_{CM} = V_{IN-} = 48\text{V}$

4.1 REM (VQFN – 14) Package

[Figure 4-1](#) shows the INA75X-Q1 pin diagrams for the REM (VQFN – 14) package. For a detailed description of the device pins please refer to the corresponding *Pin Configuration and Functions* sections in the [INA750x](#) and [INA751x](#) datasheets.

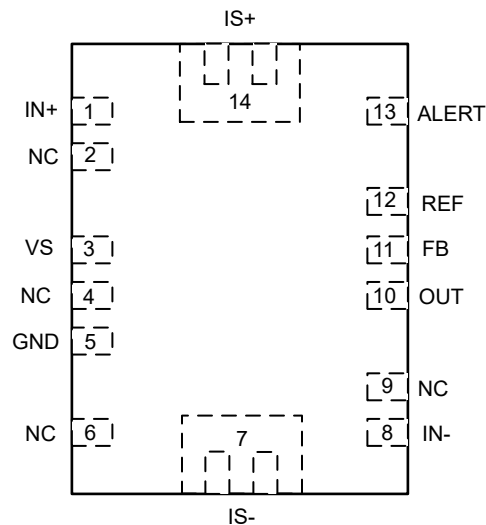


Figure 4-1. Pin Diagram REM (VQFN – 14) Package

Table 4-2. Pin FMA for Device Pins Short-Circuited to Ground

Pin Name	Pin No.	Description of Potential Failure Effects	Failure Effect Class
IN+	1	A short from the bus supply to GND occurs. High current flows from the bus supply to GND. Damage to the internal bond wires is possible.	A
NC	2	The device operates as normal.	D
VS	3	The power supply is shorted to GND. There is no power to the device.	B
NC	4	The device operates as normal.	D

Table 4-2. Pin FMA for Device Pins Short-Circuited to Ground (continued)

Pin Name	Pin No.	Description of Potential Failure Effects	Failure Effect Class
GND	5	The device operates as normal.	D
NC	6	The device operates as normal.	D
IS-	7	In a high-side configuration, a short from the bus supply to GND occurs. High current flows from the bus supply to GND. The shunt is potentially damaged due to high current.	A
		In a low-side configuration, normal operation.	D
IN-	8	In a high-side configuration, a short from the bus supply to GND occurs. High current flows from the bus supply to GND. Damage to the internal bond wires is possible.	A
		In a low-side configuration, normal operation.	D
NC	9	The device operates as normal.	D
OUT	10	The output is shorted to GND.	B
FB	11	The output voltage becomes unpredictable.	B
REF	12	The device operates as normal if REF = GND by design.	D
		If REF ≠ GND by design, the functionality of the device is affected.	B
ALERT	13	The ALERT pin is forced to active mode. There is a loss of the functionality of the ALERT pin.	B
IS+	14	A short from the bus supply to GND occurs in a high-side configuration. The functionality of the system is affected in a high-side or low-side configuration.	B

Table 4-3. Pin FMA for Device Pins Open-Circuited

Pin Name	Pin No.	Description of Potential Failure Effects	Failure Effect Class
IN+	1	The device operates as normal.	D
NC	2	The device operates as normal.	D
VS	3	There is no power to the device.	B
NC	4	The device operates as normal.	D
GND	5	There is no power to the device.	B
NC	6	The device operates as normal.	D
IS-	7	The bus supply to the load path is cut off and load current does not flow.	C
IN-	8	The device operates as normal.	D
NC	9	The device operates as normal.	D
OUT	10	The output can be left open.	C
FB	11	The output becomes unpredictable	B
REF	12	The output becomes unpredictable	B
ALERT	13	The ALERT pin is open. There is a loss of the functionality of the ALERT pin.	B
IS+	14	The bus supply to the load path is cut off and load current does not flow.	C

Table 4-4. Pin FMA for Device Pins Short-Circuited to Adjacent Pin

Pin Name	Pin No.	Shorted to	Description of Potential Failure Effects	Failure Effect Class
IN+	1	2 – NC	The device operates as normal.	D
NC	2	3 – VS	The device operates as normal.	D
VS	3	4 – NC	The device operates as normal.	D
NC	4	5 – GND	The device operates as normal.	D
GND	5	6 – NC	The device operates as normal.	D
NC	6	7 – IS-	In a high-side configuration, damage to the device is possible.	A
			In a low-side configuration, the device operates as normal.	D
IS-	7	8 – IN-	The device operates as normal.	D
IN-	8	9 – NC	The device operates as normal.	D
NC	9	10 – OUT	The device operates as normal.	D

Table 4-4. Pin FMA for Device Pins Short-Circuited to Adjacent Pin (continued)

Pin Name	Pin No.	Shorted to	Description of Potential Failure Effects	Failure Effect Class
OUT	10	11 – FB	The device operates as normal if the OUT pin is shorted to the FB pin by design	D
			If the OUT pin is not shorted to the FB pin by design, the functionality of the device is affected.	C
FB	11	12 – REF	The functionality of the output is affected.	C
REF	12	13 – ALERT	The functionalities of both the output and ALERT pins are affected.	B
ALERT	13	14 – IS+	In a high-side configuration, damage to the device is possible.	A
			In a low-side configuration, there is a loss of the functionality of the ALERT pin.	B
IS+	14	1 – IN+	The device operates as normal.	D

Table 4-5. Pin FMA for Device Pins Short-Circuited to VS

Pin Name	Pin No.	Description of Potential Failure Effects	Failure Effect Class
IN+	1	In a low-side configuration, a short from the pin VS to GND occurs. In a high-side configuration, the bus supply is shorted to the VS pin. Damage to the device is possible.	A
NC	2	The device operates as normal.	D
VS	3	The device operates as normal.	D
NC	4	The device operates as normal.	D
GND	5	The power supply is shorted to GND. There is no power to the device.	B
NC	6	There is a slight increase in quiescent current. The device functionality not affected.	C
IS–	7	In a high-side configuration, a short from the bus supply to the VS pin occurs. High current flows from the bus supply to the VS pin or from the VS pin to the bus supply. Damage to the device is possible.	A
		In a low-side configuration, the functionality of the system is affected negatively but the device is not negatively affected.	C
IN–	8	In a high-side configuration, a short from the bus supply to the VS pin occurs. High current flows from the bus supply to the VS pin or from the VS pin to the bus supply. Damage to the device is possible.	A
		In a low-side configuration, the functionality of the system is affected negatively but the device is not negatively affected.	C
NC	9	The device operates as normal.	D
OUT	10	The output is shorted to the power supply.	B
FB	11	The output becomes unpredictable.	B
REF	12	The device operates as normal if REF = VS by design.	D
		If REF ≠ VS by design, the functionality of the device is affected.	B
ALERT	13	There is a loss of the functionality of the ALERT pin.	B
IS+	14	In a low-side configuration, a short from the VS pin to GND occurs. In a high-side configuration, the bus supply is shorted to the VS pin. Damage to the device is possible.	A

5 Revision History

NOTE: Page numbers for previous revisions may differ from page numbers in the current version.

DATE	REVISION	NOTES
November 2025	*	Initial Release

IMPORTANT NOTICE AND DISCLAIMER

TI PROVIDES TECHNICAL AND RELIABILITY DATA (INCLUDING DATASHEETS), DESIGN RESOURCES (INCLUDING REFERENCE DESIGNS), APPLICATION OR OTHER DESIGN ADVICE, WEB TOOLS, SAFETY INFORMATION, AND OTHER RESOURCES "AS IS" AND WITH ALL FAULTS, AND DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE OR NON-INFRINGEMENT OF THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

These resources are intended for skilled developers designing with TI products. You are solely responsible for (1) selecting the appropriate TI products for your application, (2) designing, validating and testing your application, and (3) ensuring your application meets applicable standards, and any other safety, security, regulatory or other requirements.

These resources are subject to change without notice. TI grants you permission to use these resources only for development of an application that uses the TI products described in the resource. Other reproduction and display of these resources is prohibited. No license is granted to any other TI intellectual property right or to any third party intellectual property right. TI disclaims responsibility for, and you fully indemnify TI and its representatives against any claims, damages, costs, losses, and liabilities arising out of your use of these resources.

TI's products are provided subject to [TI's Terms of Sale](#), [TI's General Quality Guidelines](#), or other applicable terms available either on [ti.com](#) or provided in conjunction with such TI products. TI's provision of these resources does not expand or otherwise alter TI's applicable warranties or warranty disclaimers for TI products. Unless TI explicitly designates a product as custom or customer-specified, TI products are standard, catalog, general purpose devices.

TI objects to and rejects any additional or different terms you may propose.

Copyright © 2025, Texas Instruments Incorporated

Last updated 10/2025